
 




## AI85014 Twinax Socket Contact Assembly Instructions

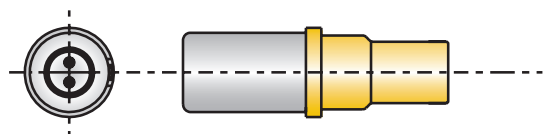

Socket Contact




100 Ohm Parallel Cable

B

### STEP 1

1. Strip cable to dimensions shown.  
**Be careful not to flare braid open.**
2. Pre-tin conductor and braid shield.
3. Clean the solder joint with alcohol.

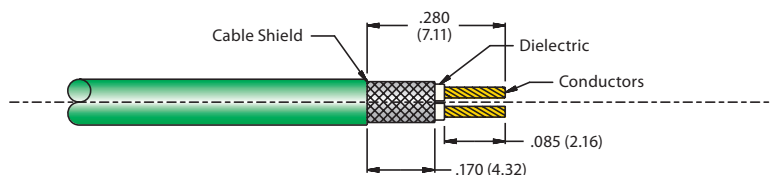


### STEP 2

1. Insert cable into socket contact.  
**Make sure center conductor lines up to the center socket.**




### STEP 3

 1. Install center conductors until they bottom-out in the contact cavity.  
**Inspect to ensure cable shield is visible through the inspection hole.**
2. Apply flux and solder through the inspection hole; remove residues and contamination with alcohol after soldering.



### STEP 4

1. Install M23053/5-204 or M23053/6-204 shrink tubing; cover solder area and extend insulation by minimum of one wire diameter.

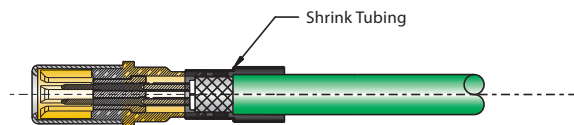

### STEP 5

1. Illustrates final assembly.

