
Features

5mm Package InGaAIP Technology All Plastic Mold Type Water Clear Lens Fast Response Time, Capable of Pulse Operation High Power Luminous Intensity

Applications

Outdoor Message Signboard Safety equipment Automotive

Toshiba TLxH157 Series LEDs

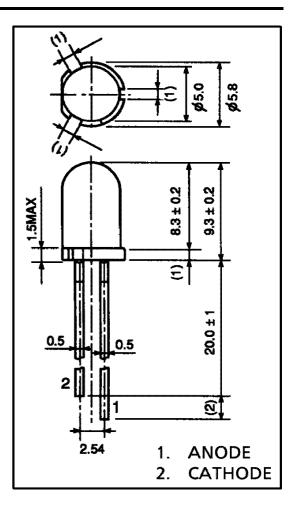

Series Line-Up

Part Number	Color	Material							
TLOH157P	Ultra Bright Orange	InGaAlP							
TLRH157P	Ultra Bright Red	InGaAlP							
TLRMH157P	Ultra Red	InGaAlP							
TLSH157P	Ultra Bright High Efficency Red	InGaAIP							
TLYH157P	Ultra Bright Yellow	InGaAlP							

Maximum Ratings (Ta=25°C)

Part Number	Forward Current	Reverse Voltage VR	Power Dissipation PD	Operating Temperature Topr	Storage Temperature Tstg		
TLOH157P	50	4	125.00	-30 ~ 85	-40 ~ 120		
TLRH157P	50	4	125.00	-30 ~ 85	-40 ~ 120		
TLRMH157P	50	4	125.00	-40 ~ 100	-40 ~ 120		
TLSH157P	50	4	125.00	-30 ~ 85	-40 ~ 120		
TLYH157P	50	4	125.00	-30 ~ 85	-40 ~ 120		
Unit	mA	V	mW	°C	°C		

Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314

Toshiba TLxH157 Series LEDs

Part Number	PWL nm λP	Material	View Angle	Luminous Intensity			Forward Voltage				Rev Current		
			2 θ1/2	min.	typ.	max.	IF@	min.	typ.	max.	IF@	max.	VR@
TLOH157P	612	InGaAIP	22 [°]	850.00	2800.00	-	20mA	-	2.10	2.50	20mA	50	4V
TLRH157P	644	InGaAIP	22 [°]	476.00	1700.00	-	20mA	-	1.90	2.50	20mA	50	4V
TLRMH157P	636	InGaAIP	22 [°]	850.00	2240.00	_	20mA	-	2.05	2.50	20mA	50	4V
TLSH157P	623	InGaAIP	22 [°]	850.00	2700.00	_	20mA	-	2.10	2.50	20mA	50	4V
TLYH157P	590	InGaAIP	22 [°]	850.00	2500.00	_	20mA	-	2.10	2.50	20mA	50	4V
-	nm	-	deg		mcd		-		۷		-	μ Α	-

Electrical and Optical Characteristics (Ta=25°C)

Precautions

- Soldering temperature: 260°C max, soldering time: 3 s max (soldering portion of lead: up to 2 mm from the body of the device).
- If the lead is formed, the lead should be formed up to 5 mm from the body of the device without forming stress to the resin. Soldering should be performed after lead forming.
- This visible LED lamp also emits some IR light. If a photodetector is located near the LED lamp, please ensure that it will not be affected by this IR light.

NOTICE:

- TOSHIBA is continually working to improve the quality and reliability of its products. Nevertheless, semiconductor devices in general can malfunction or fail due to their inherent electrical sensitivity and vulnerability to physical stress. It is the responsibility of the buyer, when utilizing TOSHIBA products, to comply with the standards of safety in making a safe design for the entire system, and to avoid situations in which a malfunction or failure of such TOSHIBA products could cause loss of human life, bodily injury or damage to property.
- In developing your designs, please ensure that TOSHIBA products are used within specified operating ranges as set forth in the most recent TOSHIBA products specifications. Also, please keep in mind the precautions and conditions set forth in the "Handling Guide for Semiconductor Devices," or "TOSHIBA Semiconductor Reliability Handbook" etc..
- The TOSHIBA products listed in this document are intended for usage in general electronics applications (computer, personal equipment, office equipment, measuring equipment, industrial robotics, domestic appliances, etc.). These TOSHIBA products are neither intended nor warranted for usage in equipment that requires extraordinarily high quality and/or reliability or a malfunction or failure of which may cause loss of human life or bodily injury ("Unintended Usage"). Unintended Usage include atomic energy control instruments, airplane or spaceship instruments, transportation instruments, traffic signal instruments, combustion control instruments, medical instruments, all types of safety devices, etc.. Unintended Usage of TOSHIBA products listed in this document shall be made at the customer's own risk.
- Gallium arsenide (GaAs) is a substance used in the products described in this document. GaAs dust and fumes are toxic. Do not break, cut or pulverize the product, or use chemicals to dissolve them. When disposing of the products, follow the appropriate regulations. Do not dispose of the products with other industrial waste or with domestic garbage.
- The information contained herein is presented only as a guide for the applications of our products. No responsibility is assumed by TOSHIBA CORPORATION for any infringements of intellectual property or other rights of the third parties which may result from its use. No license is granted by implication or otherwise under any intellectual property or other rights of TOSHIBA CORPORATION or others.
- The information contained herein is subject to change without notice.


Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314

Toshiba TLxH157 Series LEDs

TLOH157P Graphs

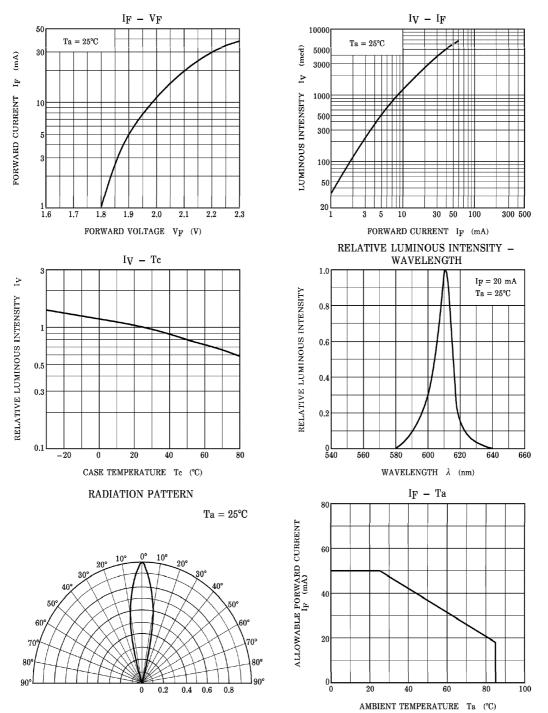


Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314

Toshiba TLxH157 Series LEDs

TLRH157P Graphs

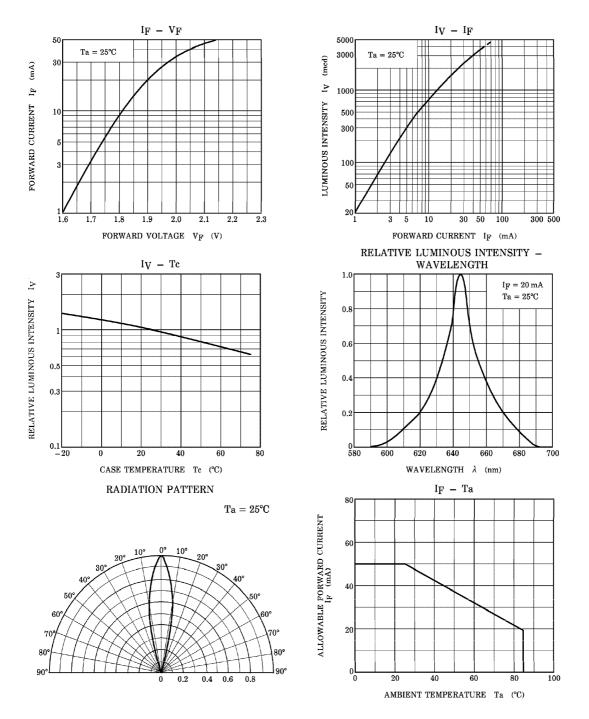


Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314

Toshiba TLxH157 Series LEDs

TLRMH157P Graphs

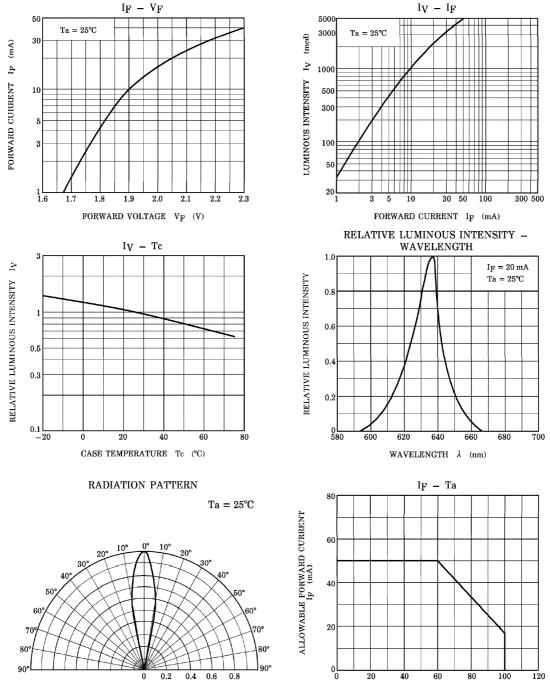

AMBIENT TEMPERATURE Ta (°C)


Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314

Toshiba TLxH157 Series LEDs

TLSH157P Graphs

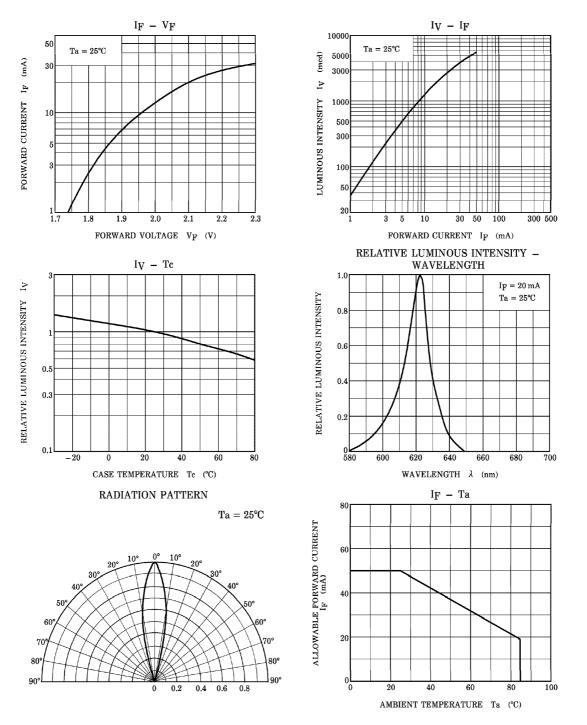


Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314

Toshiba TLxH157 Series LEDs

TLYH157P Graphs

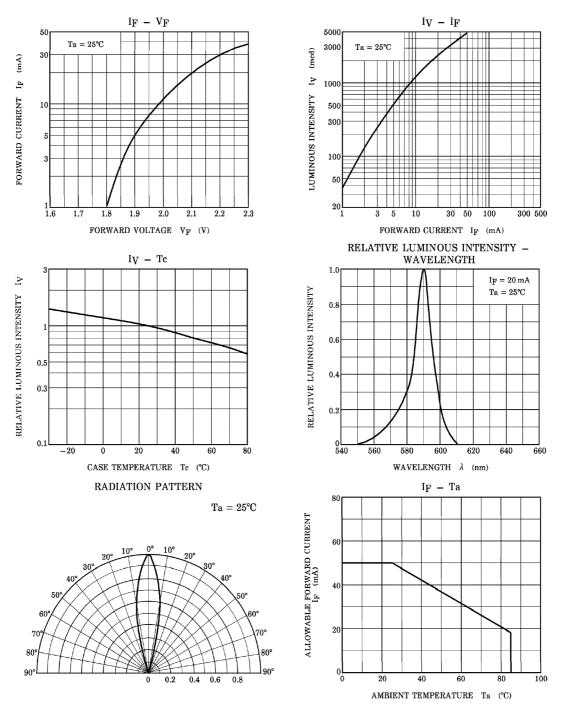

Company Headquarters 120 Broadway Menands, New York 12204 Toll Free: 800.984.5337 Fax: 518.432.7454



West Coast Sales Office 950 South Coast Drive, Suite 265 Costa Mesa, California 92626 Toll Free: 800.984.5337 Fax: 714.850.9314